

LAB III

COLD-WORKING AND ANNEALING OF BRASS

Study Questions

1. Using a stress-strain curve, define and describe the following terms:
 - yield stress
 - tensile strength
 - ductility
 - toughness
2. Consider a piece of metal being deformed in tension.
 - Shown is a typical stress-strain curve for this material (Fig 1). Label the yield stress and ultimate tensile stress.
 - Show how you would calculate the ductility from the stress-strain curve.
 - Rank the values of the hardness for the following strains: 0.005, 0.01, 0.025, 0.045, and 0.075.
3. Lead remains ductile if worked at room temperature, while copper hardens significantly. Explain.
4. Draw comparative stress-strain curves for a soft and ductile metal like Cu, a mild steel, and a cast iron.
5. Consider a FCC unit cell. Identify a slip plane and slip direction. Together they make up a "slip system". How many equivalent slip systems does the FCC structure have? Why are slip systems important?

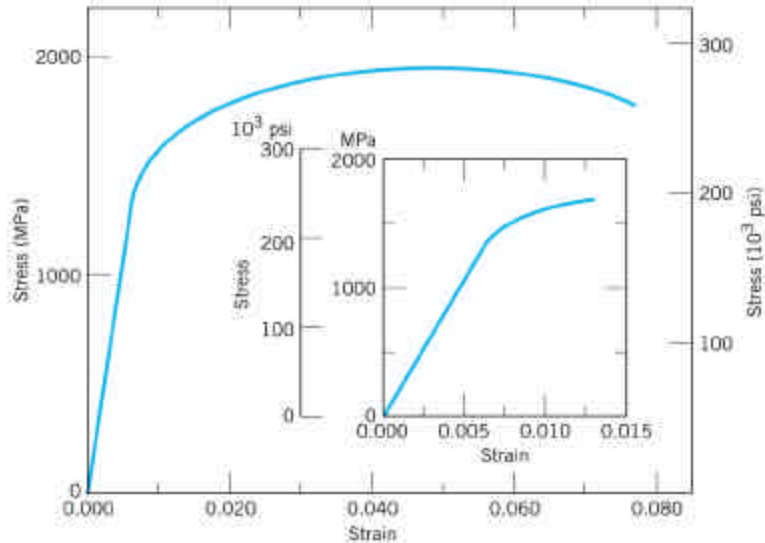


Figure 1. Stress strain curve for high strength steel

Effects of Work Hardening and Heat Treatment on Brass and Steel

Purpose:

- To observe the effect of cold working on the mechanical properties of a metal by measuring the hardness before and after cold working.
- To determine the relation between the hardness and degree of cold work by plotting the measured hardness values as a function of the amount of cold rolling.
- To investigate the effect of cold working on the microstructure.
- Investigate the effect of the annealing process on the change of mechanical properties.

Experimental Procedure:

Cold Working of Brass

- Six different examples will be tested during each lab period, with the samples to be divided amongst the different groups. At the end of the period all of the data will be pooled together.

Samples:

- As Received prior to annealing.
- Annealing at 500 degrees C
- 20% Cold Worked
- 40% Cold Worked
- 60% Cold Worked
- 60% Cold Worked then Annealed

The annealed sample at 500 degree C will be prepared in advance by Lead TA.

Procedure:

1. Measure the initial dimensions of all the samples using the calipers provided in class.
2. Measure the final dimensions of the cold rolled samples. The as received sample refers to the state in which the samples were when initially purchased. Their hardness will reflect the processing method used to form them.
3. Measure the hardness of all the samples on the Rockwell tester, use the B scale. Take at least 5 measurements on each sample and average the value. Be careful not to place indents too close together as it may affect the results. Include a plot of hardness versus percent cold work in your lab.
4. Polished samples of each type will be provided by the TA's. These samples were polished to a 1 micron finish and then chemically etched to reveal the grain boundaries. View each of the samples, comment on the microstructures in your lab report and make sketches of the microstructures and include them in your report.

Questions: (Please answer these questions in your lab write-up)

1. What is the composition(s) of ALPHA-brass? Look up the appropriate phase diagram in the text. What is the crystal structure of ALPHA-brass? What other metals share this structure?
2. Which properties of metals are improved through cold working? Which are not? Explain.
3. How is the percent of cold work calculated?
4. When the samples are rolled they get thinner and longer. Did the width (i.e. the dimension transverse to the rolling direction) increase? Did the volume of the bars change with cold working? Would you expect it to? Why or why not?
5. Were there any noticeable changes in the microstructure with cold working? How did it change? What happened to the microstructure during the annealing? How did the annealed as received sample compare to the annealed 60% cold worked sample? What conclusions can you draw between hardness data and the microstructural observations?
6. How would you expect the microstructure to change with cold rolling? How would an annealed sample look? Sketch the side, top and end on views of the structure for the rolled and annealed samples.

Lab Report

The lab report should address all the questions above but should not consist only of these questions only. Please follow the procedures outlined on the homepage and in the lab packet. Look under **short report** grading criteria for point distribution and requirements.

References:

1. E.C. Subbarao, et al., "Experiments in Materials Science," McGraw-Hill, New York, (1972).
2. George L. Kehl, "The Principles of Metallographic Laboratory Practice," 3rd ed., McGraw-Hill, New York (1949) 232-240.
3. L. Van Vlack, "Elements of Material Science and Engineering," 6th ed., Addison Wesley, Reading, MA (1986) pp. 257-262, 292-304.
4. R.E. Smallman, "Modern Physical Metallurgy," 4th ed., Butterworths, London, (1985) 335-379.